YEGAYIEW2.5

Bring light into the darkness.

bright, brighter. vegaview.



• optrel

SEE WHAT YOU CAN DO

Bring light into the darkness.


Shade Level

Ч.О

Industry Standard



Light Transmission

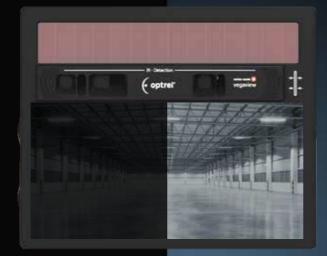

Shade Level

2.5

vegaview2.5



Light Transmission


Until Now

This is how you see your surroundings today when performing tasks like job preparation, weld inspection, or grinding.

New

The **vegaview2.5** opens up a whole new visual experience to you in light state. The much brighter view of your working environment increases both safety and efficiency in the workplace.

Thanks to optrel's latest optic technology, you can enjoy a detailed and true-colour view of the welding process at shade levels 8-12.



For the ultimate in all-round convenience when welding and grinding. Perfect when combined with optrel e3000X PAPR respiratory system.

Best view for welders.



ADF Shade level 2,5 / 8-12

The optrel vegaview2.5 lets the welders' most desired wish come true: bright view. With its ADF view with shade level 2.5, vegaview2.5 improves the visibility of welders' environment by 400%! Compared with traditional autodarkening welding helmets, vegaview2.5 sets the world record in the light state!



Respiratory Protection

The vegaview2.5 is perfectly combined with the optrel e3000X PAPR respiratory system. With its integrated high-performance particle filter (TH3), welders are adequately protected against smoke, gas, and dust.



Grind mode

By simply clicking a button the grind mode is activated, and autodarkening mode is disabled, enabling you to see your surroundings in light state 2.5 as you grind.



Lightweight

Weighting only 482 g (17 oz), the vegaview 2.5 is one of the lightest autodarkening welding helmets available. Its ergonomic design minimizes strain on the head and neck, ensuring comfort throughout the work day.




TrueColor Filter

Thanks to a special UV/IR filter, the **vegaview2.5** offers a real color experience never seen before and finally brings color into the world of welding.



2+1 Year Warranty

Register your optrel **vegaview2.5** online and receive an additional year of warranty for free.

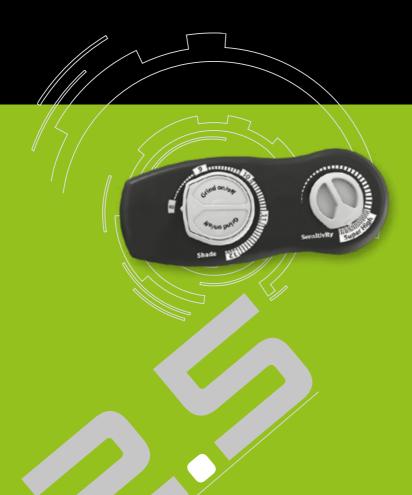

You will see better:

- · in job preparation
- · when welding
- · during weld inspection
- · when grinding
- · when stitching

Better visibility increases safety, convenience, and efficiency in the workplace.

bright. brighter. vegaview.



Technical Data

Type description	Welding mask with extra bright view in the light state (shade level SL 2.5), true color filter, automatic darkening filter, infinite shade level selection from SL 8 – SL 12, grinding mode operation, infinite adjust delay from 0.05 s to 1.0 s, LED warning follow battery and grind mode	ur e table		
Light transmittance	Ultraviolet-/infrared protection (maximum at any shade setting) Infinite exterior shade level setting			
	Visible range activated: shade level 8 - 12			
	Visible range not activated: shade level 2.5			
Power supply	2 pcs batteries 3V exchangeable (CR20	32)		
Operating time batteries	Approx. 3000 hours (operating)			
Sensors	3 sensors, variable detection angle with movable sensor slider	1		
Switching time	Light to dark: 0.100 ms at room temperature 0.070 ms at 55°C / 131°F			
	Dark to light: from 0.05 s to 1.0 s adjustable			
Classification	Optical class:			
EN379	Diffusion of light class:			
	Variations in luminous transmittance class:			
	Angle dependence of luminous transmittance class:			
Shape stability	Welding mask: up to 220°C / 428°F Front cover lens: up to 137°C / 279°F			

Reflection free front cover lens and inside
cover lens
PA6.6
Black
-10°C to +70°C / 14°F to 158°F
-20°C to +80°C / -4°F to 176°F
Welding helmet: 482 g, 17.002 oz
Any electric arc welding process Electrode Welding (Stick Welding, SMAW) / MIG / MAG (GMAW) / GMAW High melting rate process / Flux Cored Wire Welding / TIG welding (GTAW) / Plasma Arc Welding / Plasmacutting & Oxy-gas Welding
Prohibited for laser welding!
Grind mode at light state SL 2.5
Welding helmet, instruction manual, storage bag, batteries, warranty card and one front cover lense
CE, ANSI, complies with CSA
2 years (except batteries) 1 year warranty extension for online product registration within the first 6 month. http://register.optrel.com

Helmet syste	e m	Item no.	Main access	sories	Item no.
19	vegaview2.5 welding helmet	1006.600		optrel parking buddy	5002.900
	vegaview2.5 welding helmet with industrial helmet	1006.650		Front cover lens (2 pcs.) Front cover lens (5 pcs.)	5000.210 5000.212
29	vegaview2.5 fresh air helmet	4441.800		Adjustable headband	5003.250
	vegaview2.5 fresh air helmet with industrial helmet	4441.850		optrel bag for helmets	8000.100
				וח וו	
				KAS-01/-	1000
			1 Front cove	and accessories er lens (2 pcs.) er lens (5 pcs.)	Item no. 5000.210 5000.212
			1 Front cove	er lens (2 pcs.)	5000.210
2			1 Front cove Front cove 2a Helmet sh	er lens (2 pcs.) er lens (5 pcs.)	5000.210 5000.212
2			1 Front cove Front cove 2a Helmet sh 2b PAPR helm	er lens (2 pcs.) er lens (5 pcs.) nell vegaview2.5	5000.210 5000.212 5001.635
			1 Front cove Front cove 2a Helmet sh 2b PAPR helm 3 Spare ADI 4 Inside cov	er lens (2 pcs.) er lens (5 pcs.) eel vegaview2.5 met shell vegaview2.5 F cartridge vegaview2.5 ver lens (5 pcs.)	5000.210 5000.212 5001.635 4261.005
			1 Front cove Front cove 2a Helmet sh 2b PAPR helm 3 Spare ADI 4 Inside cov 5 Adjustable	er lens (2 pcs.) er lens (5 pcs.) eel vegaview2.5 net shell vegaview2.5 F cartridge vegaview2.5 ver lens (5 pcs.) e headband (including	5000.210 5000.212 5001.635 4261.005 5012.470
			1 Front cove Front cove 2a Helmet sh 2b PAPR heln 3 Spare ADI 4 Inside cov 5 Adjustable sweatban	er lens (2 pcs.) er lens (5 pcs.) eel vegaview2.5 met shell vegaview2.5 F cartridge vegaview2.5 ver lens (5 pcs.)	5000.210 5000.212 5001.635 4261.005 5012.470 5000.001
			1 Front cove Front cove 2a Helmet sh 2b PAPR helm 3 Spare ADI 4 Inside cov 5 Adjustable sweatban 6 Cotton sw	er lens (2 pcs.) er lens (5 pcs.) nell vegaview2.5 net shell vegaview2.5 F cartridge vegaview2.5 ver lens (5 pcs.) e headband (including and comfortband)	5000.210 5000.212 5001.635 4261.005 5012.470 5000.001 5003.250
			1 Front cove Front cove 2a Helmet sh 2b PAPR heln 3 Spare ADR 4 Inside cov 5 Adjustable sweatban 6 Cotton sw 7 Comfortb	er lens (2 pcs.) er lens (5 pcs.) er lens (5 pcs.) net shell vegaview2.5 F cartridge vegaview2.5 ver lens (5 pcs.) e headband (including and comfortband) veatband (2 pcs.)	5000.210 5000.212 5001.635 4261.005 5012.470 5000.001 5003.250
			1 Front cove Front cove Front cove 2a Helmet sh 2b PAPR helm 3 Spare ADI 4 Inside cov 5 Adjustable sweatban 6 Cotton sw 7 Comfortb 8 Breast pro	er lens (2 pcs.) er lens (5 pcs.) nell vegaview2.5 net shell vegaview2.5 F cartridge vegaview2.5 ver lens (5 pcs.) e headband (including and and comfortband) veatband (2 pcs.) and (2 pcs.)	5000.210 5000.212 5001.635 4261.005 5012.470 5000.001 5003.250 5004.073 5004.020

For all those who want to have a better view at welding.

switzerland

www.optrel.com

info@optrel.com

swiss made 🕂

